



## SERVICE BULLETIN

**Issue Date:** August 30, 2017

# of pages: 1

**Issue Number:** SB-17-8-1

**Subject:** 2-Pin Bridle

**Status:** Recommended

**Identification:**

Squirrel Harness/Container System Bridles (Pre Aug 27 2017).

**Background:**


A recently delivered CRUX bridle suffered a pin hanger-loop failure. The pin detached prior to first use, during packing. All available evidence suggests that this manufacturing defect was a singular occurrence and no other bridles are affected. However, the pin-hanger junction may be difficult to inspect and verify that all layers of webbing are captured by the bartack, due to the closeness of the bartacks and length of the pin-hanger webbing.

**Service Bulletin:**

Prior to next use, inspect the bridle pin-hangers. If there is any uncertainty in the integrity of the pin-hanger assembly, stop use and contact Squirrel to obtain a replacement bridle. Replacement bridles constructed after August 28, 2017 are built to an updated design, allowing for easier inspection. Replacement bridles can be delivered in a matter of days to any affected owner. Contact Squirrel LLC for shipping of a replacement bridle at no charge.

**Compliance:**

Recommended before next use.

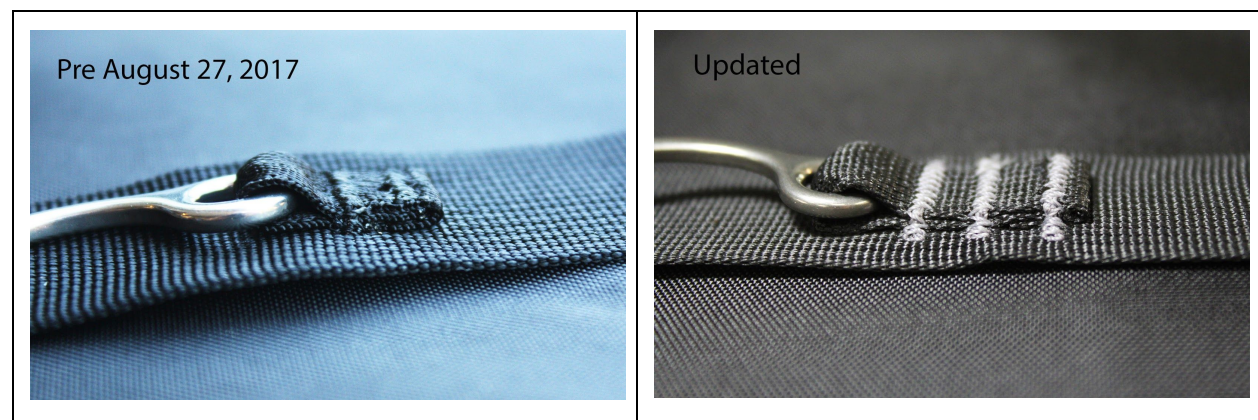

<p><b>Authority:</b> Matt Gerdes Squirrel LLC <a href="mailto:info@squirrel.ws">info@squirrel.ws</a> +1 855 359 7775</p>	<p><b>Distribution:</b> All owners of record Parachute Industry Association Squirrel LLC / Asylum Designs Dealers <a href="http://www.squirrel.ws">www.squirrel.ws</a></p>
--	--